



RHINO TRED®

RECYCLED LIGHTWEIGHT PRECAST CONCRETE STAIR TREADS & LANDING PLANK

v.1.0

Installation

During install and 72 hour after (minimum cure time). Stairwell must keep 50 degrees fahrenheit or higher. This is the minimum install and cure time temperature.

RECOMMENDED DROP ON RHINO TRED INSTALLATION



Begin installation at the top of the stair, continuing down to avoid walking on the installed product.

1. Prior to application of adhesive. Surface(s) to be dry, free of dust and debris. Using a clean cotton cloth, with solvent, wipe surface(s) where adhesive is to be applied.
2. At the bottom side of tread. At each plugged hexagon. Apply 1/4" thick adhesive, the size of a quarter.
3. Gently set the tread on to the metal flat pan. Centered between stair stringers. Base of tread is not to overhang nosing of metal flat pan.
4. Press down firmly across the tread to allow adhesive to expand across the flat pan.
5. Allow a minimum of 72 hours for adhesive cure time. Do not walk on Rhino Tred.